



SPN1 Sunshine Pyranometer

Total (Global) and Diffuse Radiation and Sunshine Duration sensor. with thermopile sensors and precision glass dome needing no routine adjustment or polar alignment.

Quick Start Guide version 3.0



AT Delta-T Devices Ltd

Weitere Infos unter vertrieb@upgmbh.com * support@upgmbh.com

Summary

This guide explains how to use the SunRead PC software to check the SPN1 is working, and how to connect to and program a GP1 data logger.

Unpacking

The SPN1 is supplied with


- Serial cable **SP-BF-RS01**
- Analogue cable **SP-BF/w-05**
- User Manual and this Quick Start Guide
- Calibration certificate

Optional accessories


- Levelling baseplate **SPN1/BP**
- Support arm **SPN1/ARM**
- Spare desiccant canisters **SPN1-SD**

Overview



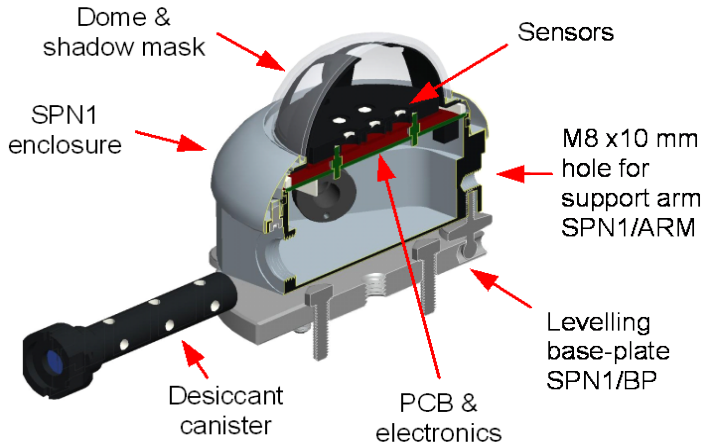

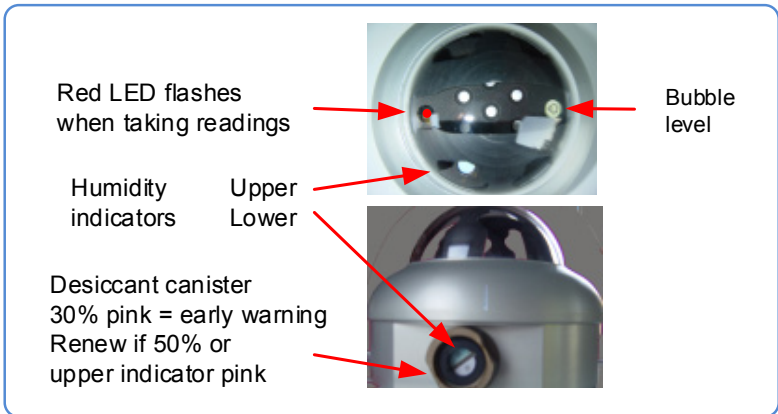



Construction



Indicators

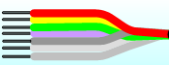

Cabling Options

CABLE OPTIONS		SPN1 end
RS232 cable	9-way serial female 	5-way M12 female 
RS232 extension cable	5-way M12 male 	5-way M12 female 
Logger cable	Flying leads 	8-way M12 female 
Logger extension cable	8-way M12 male 	8-way M12 female 

Maximum Cable Lengths

Serial cable: the maximum length usually depends on how good the line driver is in the PC, and can typically vary from 5 to 100m.


Analogue cable: 100m - provided the power supply at the SPN1 exceeds 5V at 2mA for sensor alone, or 12V at up to 1.5A for heater.

Power: Don't exceed the maximum specified supply voltage of 15V.


For a 15V supply, the heater will work as intended up to 50m cable length, and with a reduced effectiveness for longer cable lengths.

Note: **Always use differential sensor measurement when using data loggers.**
(The heater return current can cause large single-ended measurement errors).

System Cabling Options

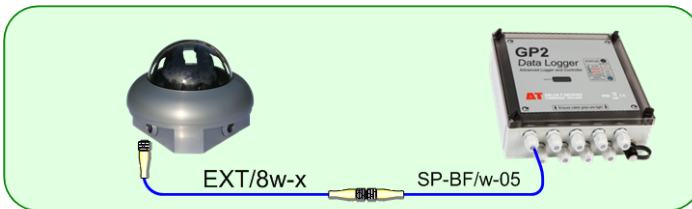


SPN1 analogue port to a data logger e.g. GP1, GP2 or DL2e

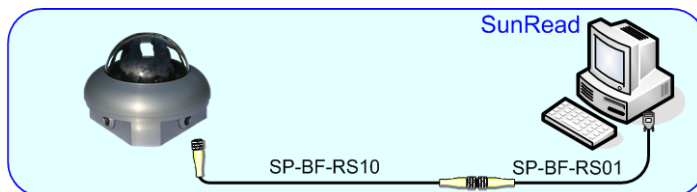


SPN1 serial port to PC running SunRead


System Overview

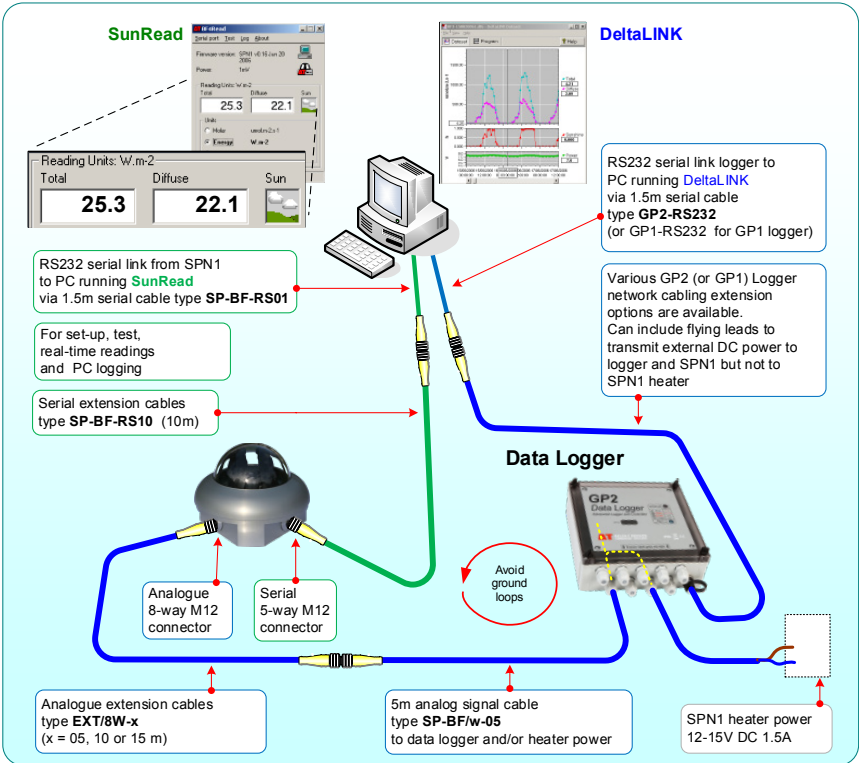


Use with a PC running SunRead

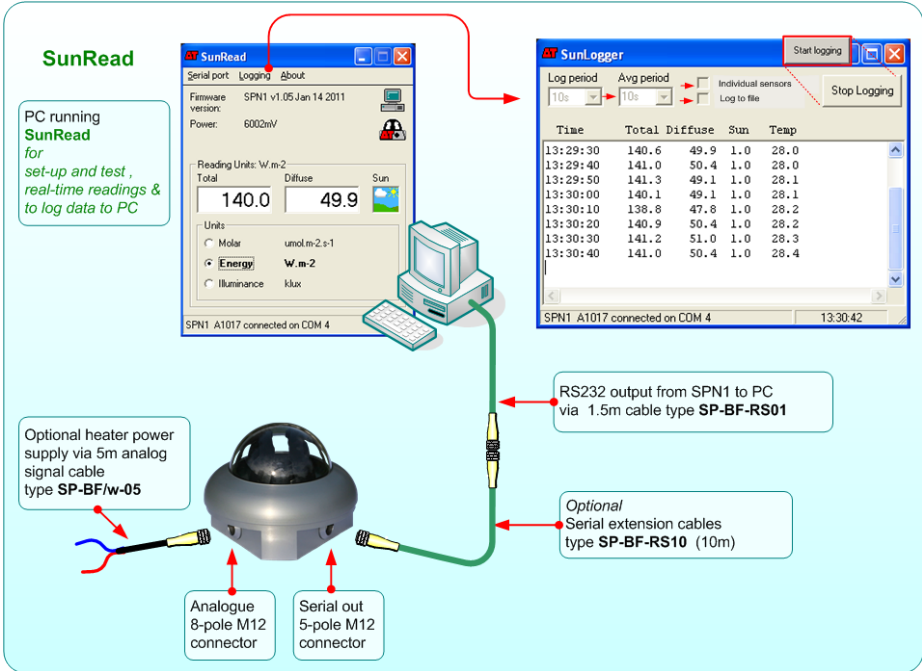


Power connection options

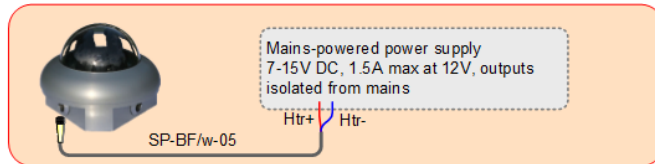

Heater power
 (To enable analogue outputs connect the separate logger warmup line - see below)

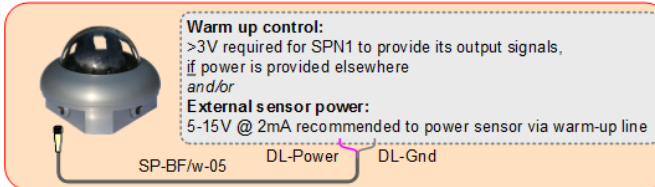

Power via logger warmup.
 Analogue outputs enabled.
 No heater.

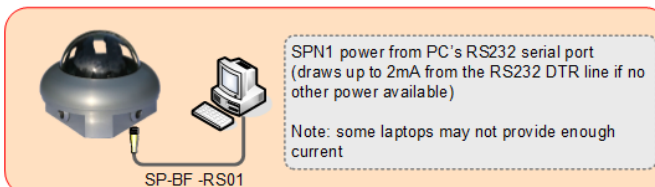

Power from PC

Use SunRead to check the SPN1

About SunRead

- **Displays Total (global) and Diffuse radiation and sunshine status**
- **Use for *setting up and testing* SPN1**
- Runs on your PC, connected directly to SPN1 via **SP-BF-RS01** cable
- Simple logging capability

Installation Requirements:

- PC running Windows XP, 7 or 8
- One free RS232 serial port, or USB-RS232 adapter
- DVD drive for software installation
- Cable **SP-BF-RS01** (not intended for outdoor use)
- Delta-T Software and Manuals DVD
- Acrobat Reader for reading documentation (free download from www.adobe.com)

Installation

1. Install the DVD in the PC. On most PCs, installation will start automatically. If it does not, run the file setup.exe in the root folder of the DVD. This will display an index of software and also of documents.
2. Click on **Install SunRead software**.
3. Check the DVD and also our website at <http://www.delta-t.co.uk/support.html> for the latest documentation and copy it to your PC if you wish.

For further installation information see SunRead Release Notes on the DVD.

Note 1: Most PCs, but not all, can power the SPN1 via the serial port. If not, power the SPN1 via the analogue cable – see the analogue cable wiring diagram.

Start SunRead

1. Connect your SPN1 to a spare serial port or via a USB-RS232 adapter to your PC, using cable **SP-BF-RS01** plugged into the 5-pole connector- see **Overview** diagram.

- Run **SunRead** to display the screen shown below.

Logging with SunRead

- Select **Log** to display the logging window.
- Enter the logging options (see below)
- Click **Start Logging**.

Logged data is displayed in real-time, and can be saved to file as .csv files which can be analysed in Excel.

Time	Total W.m-2	Diffuse W.m-2	Sunshine status	SPN1 Temperature
13:17:40	83.9	23.5	1.0	27.9
13:17:50	127.8	31.9	1.0	27.9
13:18:00	122.9	32.2	1.0	27.9
13:18:10	42.2	22.3	1.0	27.9

Logging options

Log period: sets logging frequency.

Avg period: sets averaging period.

Log to file: saves each reading to file as it is logged.

Individual sensors: records all 7 individual thermopile sensors.

See also RS232 Commands in [SPN1 User Manual](#)


Set up Data Logger

Outputs

The analogue connector provides voltage outputs for Total (global) and Diffuse radiation, plus a digital output for sunshine state.

It is suitable for recording by many data loggers via cable **SP-BF/w-05**.

Note : Avoid simultaneous connection of serial cable to a PC and analogue outputs via a logger to a PC - it may create an earth loop which may reduce signal accuracy.

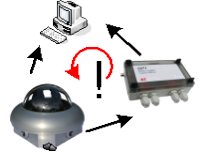

Connect analogue cable to logger

GP2: see SPN1 Info Panel in DeltaLINK, and also the GP2 User Manual.

GP1: see **SPN1 Sunshine Recorder Program** in DeltaLINK Help.

DL2e: see SPN1 sensor Help in Ls2Win (service release 5).

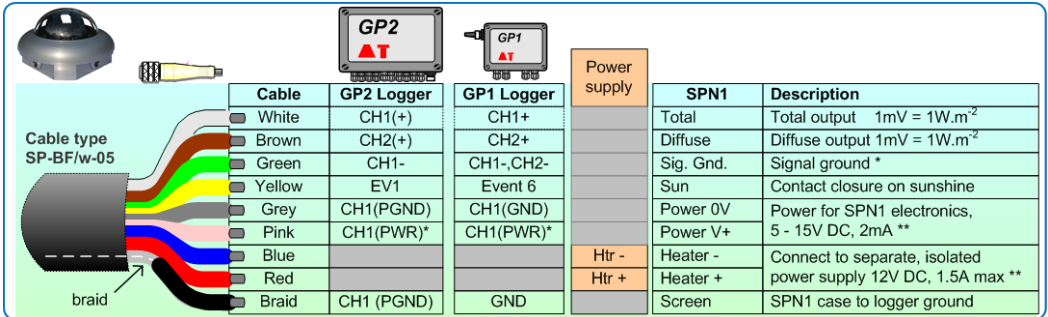


Figure 1: Wiring to GP1 and GP2 data logger and to heater power supply

* Note: Connected internally in the SPN1 to Power 0V

** Note: Analogue cable SP-BF/w-05 and serial cable SP-BF-RS01 braids are both earthed via the connector shells to the SPN1 case and terminate at the data logger or PC case or ground. To avoid ground loops do not interconnect braids elsewhere.

*** Note: SPN1 draws power from Power V+, CTS (PC serial port), or Heater +, whichever voltage is highest. Most PCs can power the SPN1 via the serial port.

Analogue cable wiring for loggers and heater

White (Total output) and **Brown** (Diffuse output): connect to data logger voltage inputs. The normal range of this output is 0V – 1.3V

Green: connect to data logger signal ground or –ve input terminal.

Yellow: connect to a data logger digital input. It gives a short circuit to ground when sunshine is present, and open circuit with no sunshine. Alternatively, connect to a resistance input with a precision resistor in parallel (see also SPN1 User Manual).

Grey 0V and **Pink V+** (SPN1 power): apply >5V to power the SPN1 and enable the sensor output signals.

Red Htr+ and **Blue Htr-** (heater power): connect to a separate, isolated 12V DC 1.5A power supply. The actual heater current depends on the temperature. In cold climates a 40Ah battery would only last one day, so use a mains-powered regulated 12V DC power adaptor.


Do not apply AC mains power to the SPN1.

Program a GP1 Logger

About DeltaLINK-PC software

- Programs the GP1 logger, starts and stops logging, displays real-time graphs, retrieves, graphs and displays logged SPN1 data.
- Runs on your PC, connected to GP1 via GP1-RS232 cable
- Includes an SPN1 logging program

You need DeltaLINK 3.0 or later installed along with the Excel Dataset Import Wizard (see Software and Manuals DVD)

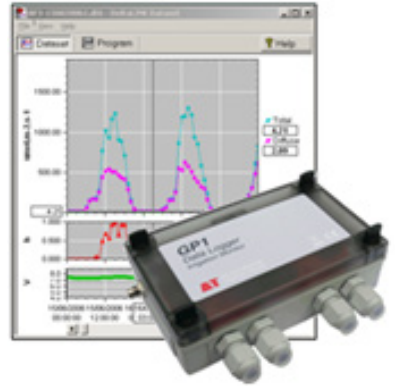

Run DeltaLINK-PC

1. Connect PC to the GP1 with cable **GP1-RS232**, either using a spare serial port or USB-RS232 adapter.
2. Run **DeltaLINK**. The GP1 should respond, populating the DeltaLINK **Logger** page with status information about the logger.
3. Click on **Program** and then **Change** to create a new logging program.
4. Select **Edit, New Program** and select **SPN1 Sunshine Recorder**.
5. Define the logging program you require, from the options as shown.

The image shows a screenshot of the 'Program1 - DeltaLINK Program' dialog box. The window title is 'Program1 - DeltaLINK Program'. The main area is titled 'SPN1 Sunshine Recorder program for GP1'. Under 'Recording options', there are several settings: 'Sample rate' is set to 3 seconds, 'Recording rate' is set to 1 hour, 'Record irradiance as' is set to 'Integral, 3.m-2', and 'Record sunshine as' is set to 'Total, sunshine hours'. There are also two checked options: 'Record power supply voltage' and 'Autowrap dataset'. Red arrows point from text annotations on the left to these specific settings in the dialog box.

Sample Rate: *the interval between sensor readings.*


Recording rate: *the interval between recorded values, i.e. the integration period.*

Record sunshine as: *select the method of recording sunshine duration.*

6. Click **Apply** to install the program in the GP1.
7. Click on the **Sensors** page and **Refresh** to show a real-time graph of Total (Global), Diffuse and sunshine status – to check everything seems to be working.
8. On the **Logger** tab select **Start** to start logging.
9. Periodically in the **Dataset** tab select **Refresh** to inspect logged data.
10. **Save** it to file.
11. To import data into Excel, install the **Dataset Import Wizard** from the Start Menu, Delta-T program group, then (in Excel 2010) select **Add Ins, Import Dataset(s)**.

Program a GP2 Logger

Before you start you need DeltaLINK connected to your GP2 or to the GP2 Simulator (see also the GP2 User Manual and/or DeltaLINK Help).

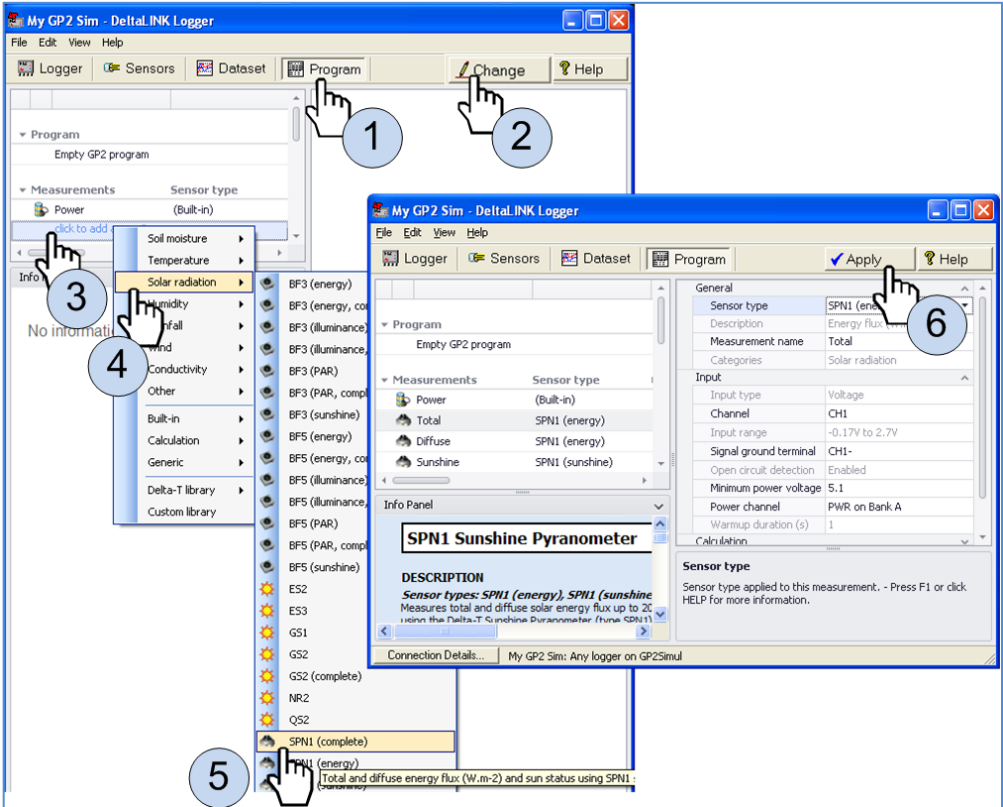

Install the SPN1 on site

It may be installed at any latitude.


Mount the SPN1 horizontally and at any polar orientation i.e. relative to North.

Use either the **Levelling baseplate** type **SPN1/BP**, or **Support arm** type **SPN1/ARM**.

M8 attachment bolts are provided with both.

Do not touch any socket cap screws under the flange holding the dome. These are sealed during manufacture.

Connect the heater power, data logger, and serial port if required, using the cables shown in the **Overview** and the wiring connections shown in Fig 1.

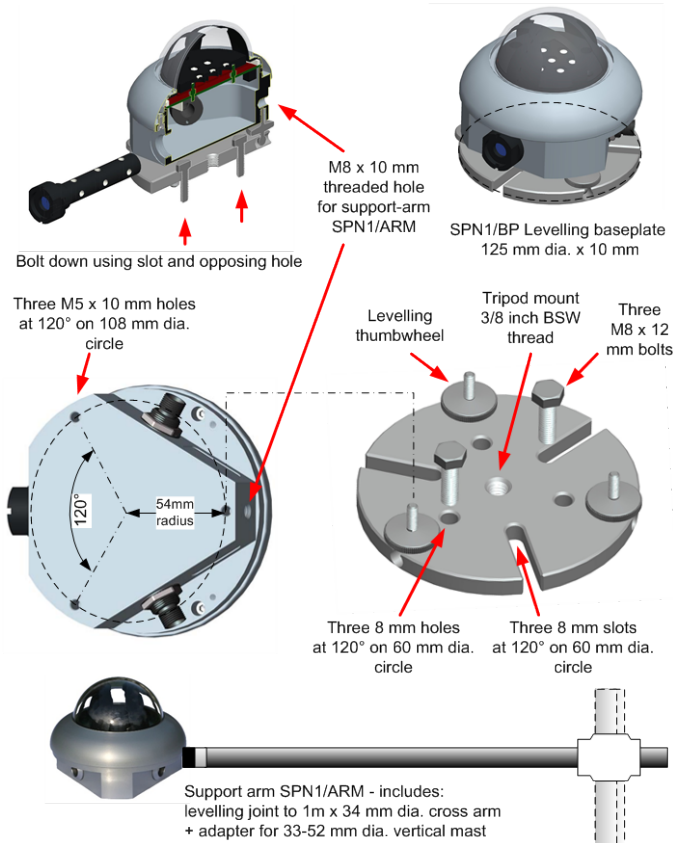

Maintenance

Keep glass dome clean using clean water with mild detergent or Isopropyl Alcohol. If any two desiccant indicators turn pink, unscrew the desiccant canister from the indicator cap, and replace with a fresh one (type SPN1-SD).

Notices: The Sunshine Pyranometer is protected by patents EP1012633 & US 6417500. EMC certification: refer to the SPN1 Regulatory Information on the Delta-T Software and Manuals DVD

Specifications

The following accuracy figures give 95% confidence limits, i.e. 95% of individual readings will be within the stated limits under normal climatic conditions. For full specs see SPN1 User Manual

Overall accuracy: Total (Global) radiation and Diffuse radiation	$\pm 5\%$ Daily integrals $\pm 5\% \pm 10 \text{ W.m}^{-2}$ Hourly averages $\pm 8\% \pm 10 \text{ W.m}^{-2}$ Individual readings
Resolution	$0.6 \text{ W.m}^{-2} = 0.6 \text{ mV}$
Range	0 to $>2000 \text{ W.m}^{-2}$
Analogue output sensitivity	$1 \text{ mV} = 1 \text{ W.m}^{-2}$
Analogue output range	0-2500 mV
Sunshine status threshold	120 W.m^{-2} in the direct beam

Other specifications

Accuracy: Sunshine status	$\pm 10\%$ sun hours with respect to the threshold
Accuracy: Cosine Correction	$\pm 2\%$ of incoming radiation over $0-90^\circ$ Zenith angle
Accuracy: Azimuth angle	$\pm 5\%$ over 360° rotation
Temperature coefficient	$\pm 0.02\%$ /°C typical
Temperature range	-20 to $+70^\circ\text{C}$
Stability	Recalibration recommended every 2 years.
Response time	$< 200 \text{ ms}$
Spectral Response	400-2700 nm
Spectral sensitivity	10% typical
Non-linearity	$< 1\%$
Tilt response	Negligible
Zero Offsets	$< 3 \text{ W.m}^{-2}$ for a $5^\circ\text{C}/\text{hour}$ change in ambient temperature $< 3 \text{ W.m}^{-2}$ dark reading
Latitude capability	-90° to $+90^\circ$
Environmental: Sealing	IP67
Sunshine status output	No sun = open circuit. Sun = short circuit to ground
Power requirement	2 mA (excluding heater power), 5 V – 15 V DC
Heater power	12 V – 15 V DC, up to 1.5 A
Heater control	Continuously variable up to 20 W output for external temperatures below 0°C
Lowest snow & ice-free temperatures (using heater)	-20°C at 0 m/s wind speed -10°C at 2 m/s wind speed
Mounting options:	3 x M5 tapped holes in base; 108mm pcd, 120° spacing. (takes optional Levelling baseplate SPN1/BP) M8 tapped hole on side (takes Support Arm SPN1/ARM)
Size & Weight	126 mm dia. x 94 mm high, 786 gm



Delta-T Devices Ltd
 130 Low Road, Burwell
 Cambridge CB25 0EJ
 UK

Tel: +44 1638 742922
Fax: +44 1638 743155
e-mail: sales@delta-t.co.uk
web: www.delta-t.co.uk